Total Quality. Assured.

TEST REPORT

Number: GZHT90810410

Applicant: TRECK SA
SANTA ROSA 5220 SAN
JOAQUIN SANTIAGO CHILE

Date: Jul 13, 2018

Attn: MR ANDRES GANDARA VELASCO

Sample Description:

Two (2) pieces of submitted samples said to be Black PVC Sheet Upper for Style V130/V230.

Standard	:	EN 13832-2:2006
Buyer's Name	:	TRECK S.A.
Colour	:	Black
Style No./Name	:	V130/V230
Country Of Origin	:	Made in China
Goods Exported To	:	Chile
Date Received/Date Test Started:		Jul. 03, 2018
Date Final Information Confirmed/ Date Payment Received:		--/ Jul. 13, 2018

Test Result Please Refer To Attached Page(S).

Should you have any query on this report, you may contact at gzfootwear@intertek.com

Authorized By:
For Intertek Testing Services Shenzhen Ltd.
Guangzhou Branch

Huang Ning, Andy
Assistant General Manager

LZ/nicoleho

Intertek Testing Services Shenzhen Limited, Guangzhou Branch
Block E, No.7-2, Caipin Road, Guangzhou Science City, Getdd Guangzhou.
深圳天祥质量技术服务有限公司广州分公司
广州经济技术开发区科学城彩频路 7 号之二 E 栋
Tel: +86 20 8213 9001 Fax: +86 20 8208 9909 Postcode: 510663

TEST REPORT Number: GZHT90810410

Tests Conducted (As Requested By The Applicant)

Footwear Protecting Against Chemicals (EN 13832-2:2006, 6.2 & EN 13832-1:2006, 4.2)

Test 1	Chemical Used		Sulfuric Acid 95% D=1.84			
	Letter code		L			
	Test		Before Degradation	After Degradation	Requirement (After Degradation)	Pass/Fail
Sample 1	Upper	Mass Change (mg)	24614.6	24986.2	-	-
		Tear Resistance (kN/m)	38.2	31.3	⩾ 6.4 kN/m	Pass
		Elongation At Break (%) (Not Applicable For Leather Upper)	222	490	Min. 178% (#1)	Pass
Sample 2	Upper	Mass Change (mg)	23214.5	23535.2	-	-
		Tear Resistance (kN/m)	26.0	24.5	⩾ 6.4 kN/m	Pass
		Elongation At Break (%) (Not Applicable For Leather Upper)	214	379	Min. 171% (#1)	Pass


Remark: #1 = 80% Of Value Before Degradation

End of Report

This report is made solely on the basis of your instructions and/or information and materials supplied by you. It is not intended to be a recommendation for any particular course of action. Intertek does not accept a duty of care or any other responsibility to any person other than the Client in respect of this report and only accepts liability to the Client insofar as is expressly contained in the terms and conditions governing Intertek's provision of services to you. Intertek makes no warranties or representations either express or implied with respect to this report save as provided for in those terms and conditions. We have aimed to conduct the Review on a diligent and careful basis and we do not accept any liability to you for any loss arising out of or in connection with this report, in contract, tort, by statute or otherwise, except in the event of our gross negligence or wilful misconduct.

Intertek Testing Services Shenzhen Limited, Guangzhou Branch
Block E, No.7-2, Caipin Road, Guangzhou Science City, Getdd Guangzhou.
深圳天祥质量技术服务有限公司广州分公司
广州经济技术开发区科学城彩频路 7 号之二 E 栋
Tel: +86 20 8213 9001 Fax: +86 20 8208 9909 Postcode: 510663

GZHT90810410

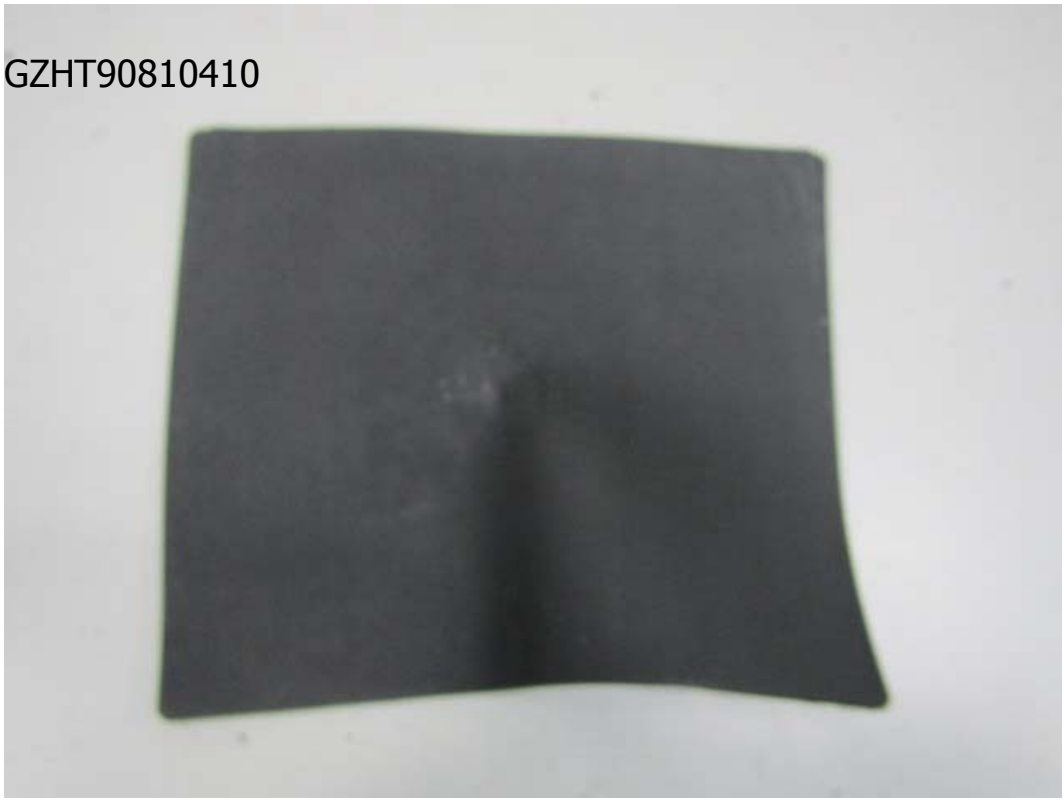

Intertek Testing Services Shenzhen Limited, Guangzhou Branch
Block E, No.7-2, Caipin Road, Guangzhou Science City, Getdd Guangzhou.
深圳天祥质量技术服务有限公司广州分公司
广州经济技术开发区科学城彩频路 7 号之二 E 栋
Tel: +86 20 8213 9001 Fax: +86 20 8208 9909 Postcode: 510663